

PACKAGING SPECIFICATION (包裝作業規範)

PAGE	1/4	REV.	J
------	-----	------	---

REVISION HISTORY (修訂履歷)

DIVISION (事業單位)	Product Development (產品開發課)	APPROVED (核 准)	CHECKED (審 核)	PREPARED (制 表)	CCH5/10'25'
--------------------	----------------------------------	-------------------	------------------	-------------------	-------------


歐品電子(昆山)有限公司

OUPHIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包裝作業規範)

☒ CONFIDENTIAL ☐ TOP SECRET	
PAGE	2/4
REV.	J

SPEC.NO.(規範編號) Q3011SPP-640

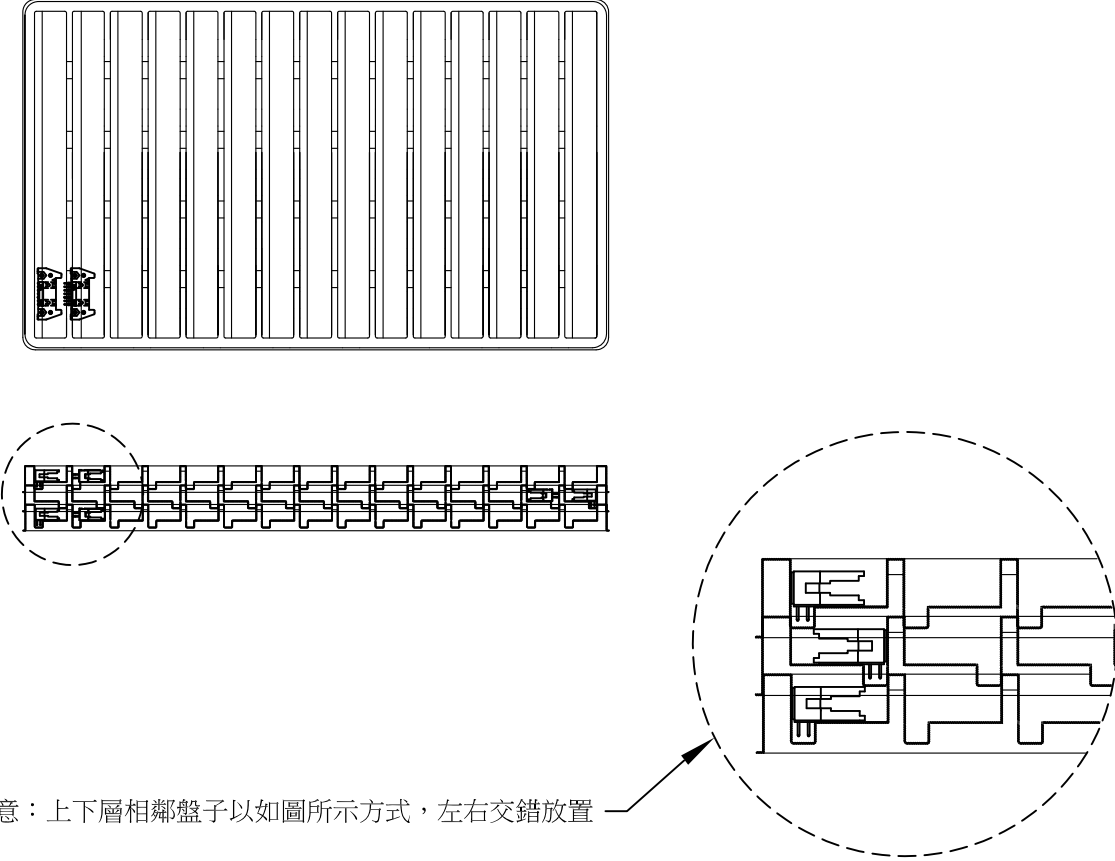PACKING OPERATION DIAGRAM & INSTRUCTION (包裝作業圖示及說明)	REMARK (備 注)
Laying Product Diagram: (產品擺放圖示)  注意：上下層相鄰盤子以如圖所示方式，左右交錯放置	一.PVC Plate Packing Mode: (PVC盤包裝方式) (1).CT-1.6 Box: PVC-3011-01 XX PCS. (CT-1.6 規格的紙箱放PVC-3011-01盤 XX PCS) (2).Put product in each trough fully as shown in diagram. (產品在盤子中擺放方式如圖所示) (3).After filling each trough with product fully,cover it with transparent upper cover PVC-3011-01 1PCS 。 (每箱放滿產品後,加蓋透明上蓋 PVC-3011-01 1PCS) (4).Stack the XX PVC plates filled with product, put them in the paper box in which has been put waterproof bag. (將放滿產品的XX個PVC盤疊起,裝入防水袋放入紙箱內)

歐品電子(昆山)有限公司

OUPIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包裝作業規範)


SPEC.NO.(規範編號) Q3011SPP-640

☒ CONFIDENTIAL ☐ TOP SECRET

PAGE 3/4 REV. J

PACKING OPERATION DIAGRAM & INSTRUCTION (包裝作業圖示及說明)

REMARK (備 注)

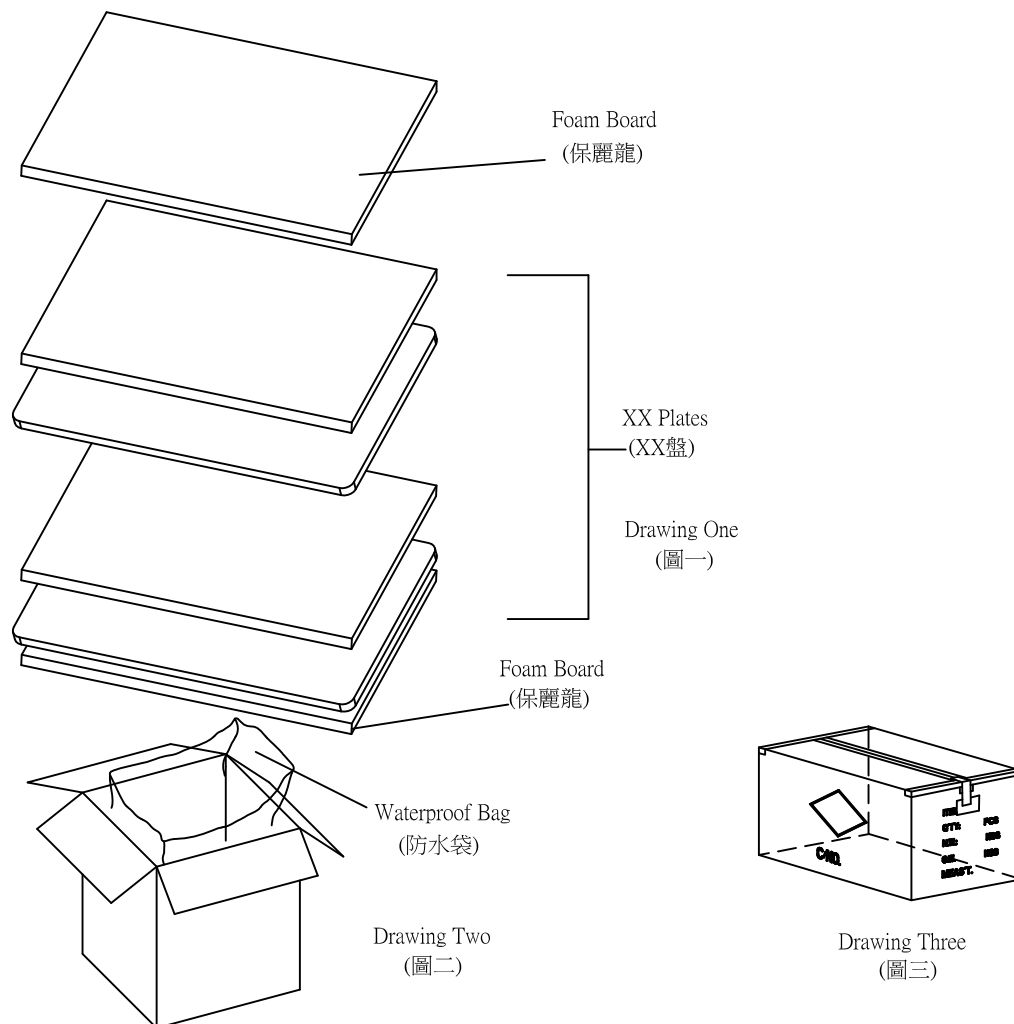

一.Outer Box Packing Mode:

(外箱包裝方式)

- (1).Paper box 1.9 or 1.6 standard 1 PCS,as shown in drawing Two.
(紙箱1.9或1.6規格 1 PCS.如(圖二)所示)
- (2).Put one Foam Board in the upper and lower of the paper box.,2PCS in all.,as shown in drawing One.
(每箱上下各放一塊保麗龍,共2PCS , 如(圖一)所示)
- (3).Put 1 PCS waterproof in the paper box,as shown in drawing Two.
(紙箱內側放入防水袋 1 PCS.如(圖二)所示)
- (4).Piled the XX packing plates packed up in the waterproof.
(將放滿產品的XX個PVC盤疊起,裝入防水袋內)
- (5).Seal the waterproof bag,then put the Foam Board 1PCS on the bag.
(Put 1 PCS Foam Board at the right and left side in the paper box if it is necessary.)
(封上防水袋,然後放上第二塊保麗龍薄板)
(必要時,在紙箱的左右兩側各放一塊保麗龍)
- (6).Seal the surface of the outer box,as shown in drawing Three.
(將外箱上層封口.如(圖三)所示)

The form on the right and flank side of the box must be filled correctly and clearly,take actual testing weight as the standard of each box gross weight.

外箱之正麥和側麥所要填寫之項目要填寫正確,清晰,每箱之毛重應以實測重量為準.

歐品電子(昆山)有限公司

OUPIIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包裝作業規範)

☒CONFIDENTIAL ☐TOP SECRET

SPEC.NO.(規範編號)	Q3011SPP-640							PAGE:	4/4	REV.	J
PACKING MATERIAL (包 裝 材 料)			PRODUCT P/N	CT NO.	PACKING N.W.	PACKING QUANTITY (包裝數量)			WEIGHT (重 量) kg		
MATERIAL NAME (材料名稱)	PART NO. (料 號)	Q'TY	(產品料號)	(紙箱規格)	(包材重量)	PCS/TRAY	TRAY/BOX	PCS/BOX	N.W./PCS	N.W./BOX	G.W./BOX
PAPER BOXES (紙箱)	CT-1.6	1	3011-10Gxx(S/R)(P)x3A	CT-1.6	5.30	105	30	3150	0.004100	12.92	18.22
Packing Box (包裝盒)	PVC-3011-01(底)	----	3011-14Gxx(S/R)(P)x3A	CT-1.6	5.30	90	30	2700	0.005740	15.50	20.80
			3011-16Gxx(S/R)(P)x3A	CT-1.6	5.30	75	30	2250	0.009010	20.27	25.57
			3011-26Gxx(S/R)(P)x3A	CT-1.6	5.30	60	30	1800	0.010660	19.19	24.49
Packing Box Cover (包裝盒蓋子)	PVC-3011-01 (蓋子)	1	3011-30Gxx(S/R)(P)x3A	CT-1.6	5.30	60	30	1800	0.013250	23.85	29.15
			3011-34Gxx(S/R)(P)x3A	CT-1.6	5.30	45	30	1350	0.013956	18.84	24.14
			3011-40Gxx(S/R)(P)x3A	CT-1.6	5.30	45	30	1350	0.014006	18.91	24.21
WATERPROOF BAG (防水袋)	PE 100X90	1	3011-50Gxx(S/R)(P)x3A	CT-1.6	5.30	30	30	900	0.014925	13.43	18.73
			3011-60Gxx(S/R)(P)x3A	CT-1.6	5.30	30	30	900	0.015032	13.53	18.83
			3011-64Gxx(S/R)(P)x3A	CT-1.6	5.30	30	30	900	0.015899	14.31	19.61
Foam (保麗龍)	-----	2									
DRYING AGENT (干燥劑)	-----	3									

1.NOTE:
(注意)
When the finished products have been made,take the actual weight as the standard of gross weight in each box.(成品出貨時,每箱之毛重應以實測重量為準)
When the finished products have been made,stick the proper designation list on the box according to product demand.(成品出貨時,依據出貨要求貼上相對應的標籤單)
CT-1.6 Produce goods taiwan ,CT-1.9 Produce goods shanghai. (CT-1.6出貨台灣OP ,CT-1.9出貨上海SH)
It doesn't influence the manner of packing with the gold-plated way to print word way.Can amalgamate.(印字方式跟鍍金方式不影響包裝方式,可以共用)